




SPECIALISTS IN DIRECTIONAL, HORIZONTAL,  
AND MULTI LATERAL SERVICES



16623 Aldine Westfield rd., Houston Tx. 77032 Off 281-395-5202 Sales 281-414-8100 Ship 888-841-3348

## SSES Dominator-Series Mud Motors

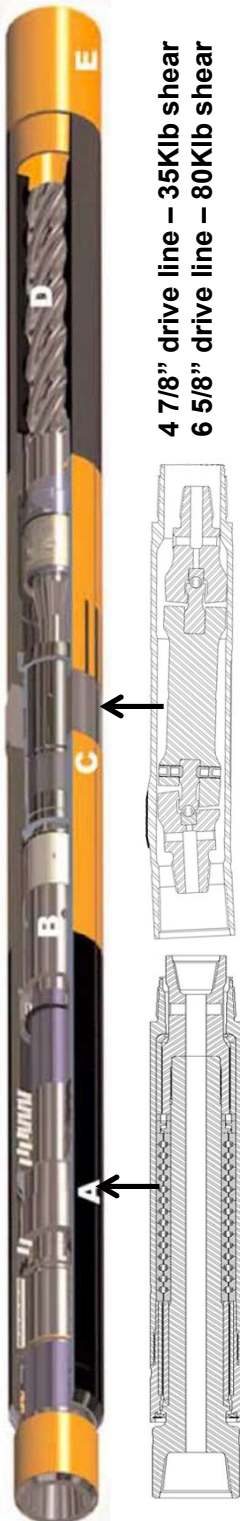

4 7/8" drive line – 35Klb shear  
6 5/8" drive line – 80Klb shear

Dominator series mud motor is a product with over 37 years of experience and expertise. With the oversized mandrels, bearings and couplings, Performance Power sections and carbide-coated rotors, the Dominator is up to any challenge that the client may have.


4 3/4"-5"-6 5/8"-7" OD fixed Patented bent bearing housing

Dominator Bent Bearing motor is a proven one-run motor for vertical, curve and lateral with one bit. Reduces 45% of the radial torsion stresses off of the bearing to transmission housing conn., mitigating cracks when using higher rotary speeds.

SIZE	CONFIG	REV/ GAL	GPM	STALL TQ
4 3/4"-5"	6/7-8.8	.79	150-350	12,060
4 3/4"-5"	5/6-8.3	1.0	100-275	7,840
6 1/2"-7"	4/5-7.0	.50	300-600	13,500
6 1/2"-7"	7/8-5.7	.23	300-600	24,000
6 1/2"-7"	7/8-6.0	.27	300-600	20,120
6 1/2"-7"	7/8-6.4	.29	300-600	24,000

ADDITIONAL POWER CONFIG. AVAILABLE ON INDIVIDUAL REQUEST

4 7/8" mandrel - 25Klb shear  
6 5/8" mandrel – 60Klb shear

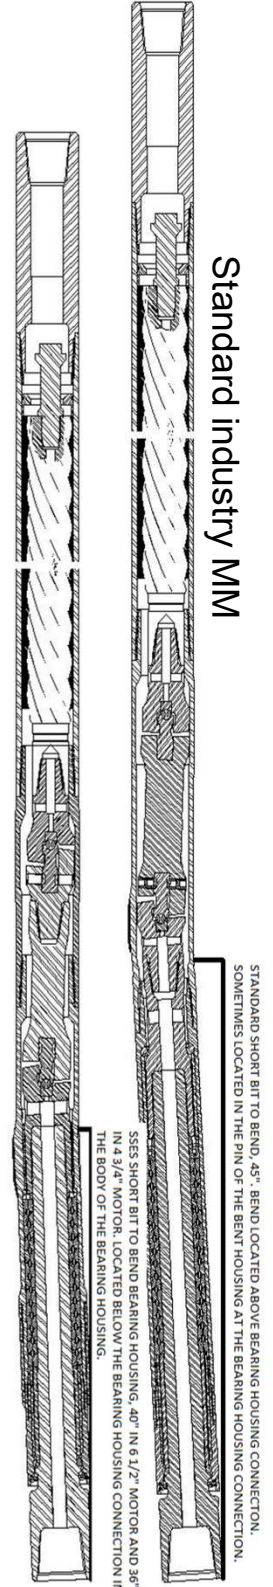

Standard industry MM

Patented SSES bent bearing MM

STANDARD SHORT BIT TO BEND, 45° BEND LOCATED ABOVE BEARING HOUSING CONNECTION. SOMETIMES LOCATED IN THE PIN OF THE BENT HOUSING AT THE BEARING HOUSING CONNECTION.


SSES SHORT BIT TO BEND BEARING HOUSING, 40° IN 6.1/2" MOTOR AND 36° IN 4.3/4" MOTOR, LOCATED BELOW THE BEARING HOUSING CONNECTION IN THE BODY OF THE BEARING HOUSING.




**SPECIALISTS IN DIRECTIONAL, HORIZONTAL,  
AND MULTI LATERAL SERVICES**



16623 Aldine Westfield rd., Houston Tx. 77032 Off 281-395-5202 Sales 281-414-8100 Ship 888-841-3348

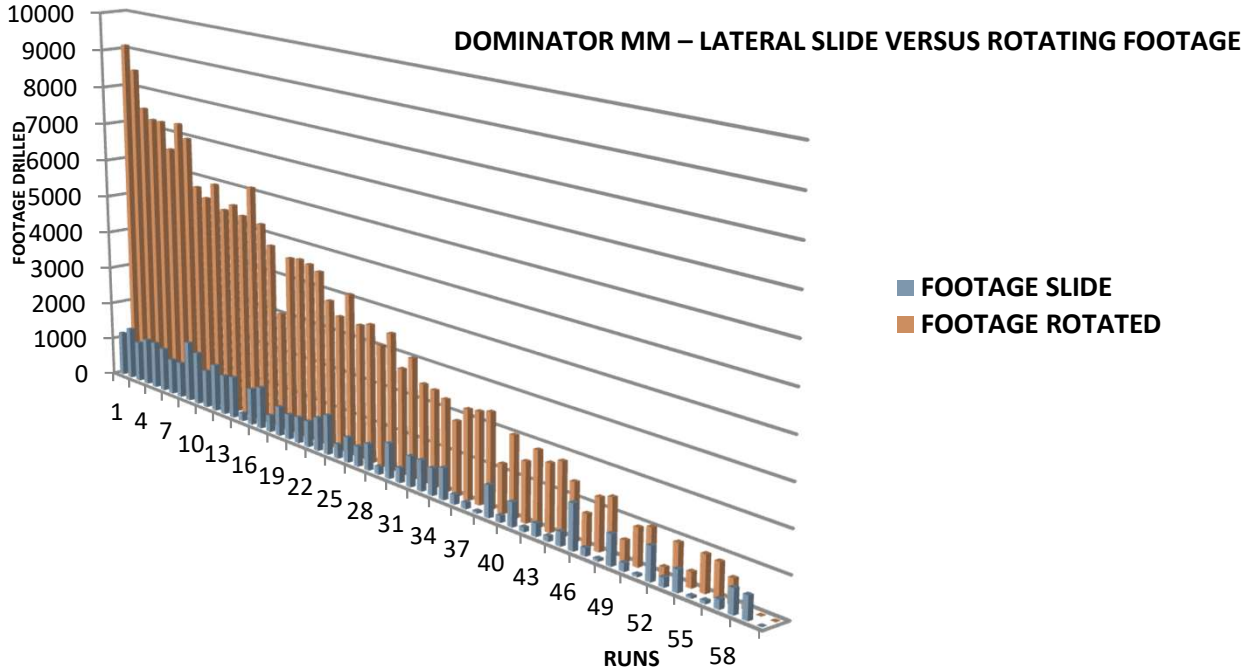

	TOTAL DRILLED	FT. SLIDE	FT. ROTATE	% SLIDE	% ROTATE
<b>AVERAGES</b>	4715.37	722.41	3939.86	16.87%	82.90%
<b>TOTALS</b>	231,053.00	35,398.00	193,053.00	15.3%	83.55%

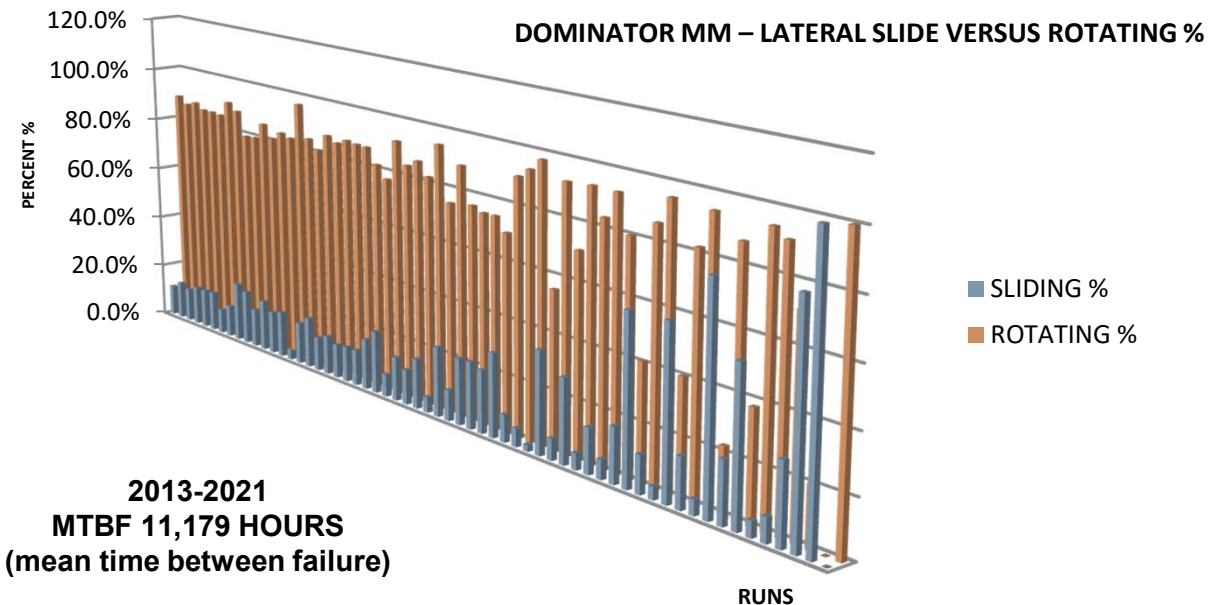

**2013-2021  
MTBF 11,179 HOURS  
(mean time between failure)**